

Kit reparatie videocoloscopu EC-3890Fi2/ A111505

I.D.: 37881755

Data publicarii 14.08.19 Coduri CPV 34913000-0

Pretul estimativ: 20.975,00 RON - 20.975,00 RON

Descriere: tie strangulat sub con la cm 150 (langa fitting), conductor de lumina deteriorat in segmentul distal (90-60%). DENUMIRE OPERATIUNI 1 Inlocuire ansamblu de insertie cu tub si canale 2 Reconditionare deflectie cu inlocuire arcuri, cabluri, camasa segment si scripeti 3 Inlocuire conductor de lumina PIESE DE SCHIMB SI MATERIALE FOLOSITE Cod Denumire Cantitate Pret Unitar(lei) Pret Total(lei) 1 D760-U5030-1 INSERTION FLEXIBLE TUBE 1 5932 5932 2 D756-U5015-2 DISTAL END ASSY WITH TUBES 1 6432 6432 3 D086-SA037 SEGMENT STEEL BRAID 1 56 56 4 D013-SA011-B1 BENDING RUBBER 1 159 159 5 D756-AA039 STAYCOIL ASSY 1 1201 1201 6 D014-AA037 ANGLE WIRE 4 130 520 7 D032-SA035 ADJUSTING COLLAR 4 30 120 8 D013-SA068 STAYCOIL COLLAR 4 30 120 9 D756-SA057-2 ROOT BRACE RUBBER IMP-1 1 325 325 10 D201-U2165 RL PULLEY ASSY 1 560 560 11 D201-U2160 UD PULLEY ASSY 1 560 560 12 D756-SA058-1 INSERTION TUBE ATTACHING NUT IMP-1 1 85 `85 13 D756-SB172-1 FWD BODY FRAME(2) IMP-1 1 173 173 14 D757-U5090 LIGHT GUIDE FIBER BUNDLE(LCB) 1 5501 5501 15 15 Set garnituri etansare 1 165 165 16 16 Adezivi, consumabile diverse 1 66 66 TOTAL 20975.00 LEI TVA 19% 3985.25 LEI TOTAL CU TVA 24960.25 LE